

Manhole Inspection Summary

Manhole # S67U__007MH

Printed On: 9/17/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **67U** Node: **007** Status: **Found**

Insp Date: **3/13/08 9:48 AM**

Incomplete Comments

Crew: **MM,TC**
Inspector: **MikeMixer**
Firm: **RJN**

Location Address: **6300 Seaforth St.**

Cross Street: **Portal St.**

Manhole Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **INCOMING 6 O'CLOCK BOTTOM DROP IS BLOCKED CAUSING OVERFLOW OUT TOP DROP LINE.**

Cover Shape: **Circular** Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Precast Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Precast Concrete** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **20** Missing: **0** ☒ **Corroded**

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S67U__007MH

Printed On: 9/17/2009

Page 2 of 3

Location View



Top View



Manhole Inspection Summary


Manhole # S67U__007MH

Printed On: 9/17/2009

Page 3 of 3

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

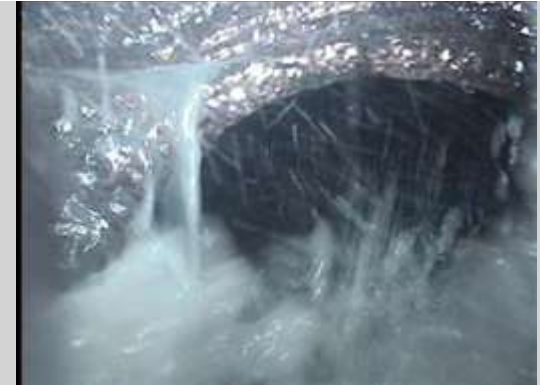

Clogged drop is causing flow to come down on out.

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **21.17** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)


Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **14.33** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

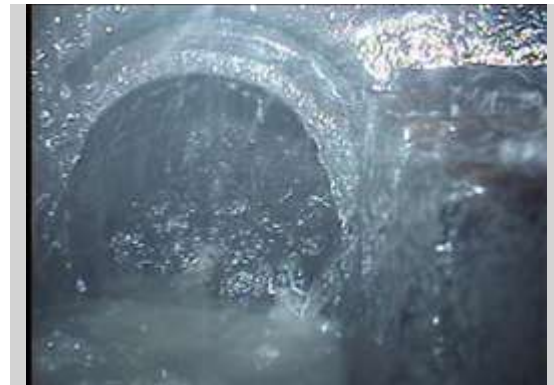

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **20.25** (ft.)

Inv Depth: **21.25** (ft.)

Drop Condition: **Clogged**

Connects To: **Manhole**

☐ Possible Illicit Connection